

customer	Vehicle Owner	Responsible Vehicle Expert
		SV-Team

inspection conditions	
support of the car seller	no
weather conditions	dry
lighting conditions	daylight
vehicle surface	dry/ clean
access to the vehicle	accessible from all sites
underbody panelling	non-existent
lifting platform / ramp / pothole	available and used
test drive completed	yes
Why wasn't it possible to do a test drive?	

vehicle					
vehicle identification number/ VIN	11603612016857	producer	Mercedes-Benz	model	450SEL
construction/design type	sedan	number of doors	4 doors	gearbox	automatic transmission
next general inspection / emission test	09.2018	pollutant class	No information available	motor fuel	petrol
mileage	65.685	first registration	29.11.1973	previous owners	unknown
previous usage	unknown	performance in kW	165	cubic capacity	4489
key	1 without remote control	colour	Blau	type of automotive paint/ lacquer	solid
smell	alright	seats	5		

☒ alright (*1)
 ☐ small damage (*2)
 ☐ severe damage (*3)
 ☐ non-existent (*4)
 ☐ not assessable (*5)

vehicle documents	
☒ permits	copy
☒ registration cert. Pt 1 / vehicle licence	copy
☒ registration cert. Pt 2 / vehicle registration document	copy
☐ service booklet	non-existent/ was not available for review
☐ log book/ radio code/ navigation software (CD)	non-existent/ was not available for review
☐ type approval	non-existent/ was not available for review
☐ HU/AU report	non-existent/ was not available for review

customer service/repairs			
date	mileage	inspection mode	Who did the servicing?
			No proof available

Remarks regarding Customer Services/Repairs
Gesamte Fahrzeug wurde neu lackiert, die Lackierung ist ok hat allerdings Lackeinschlüsse und und am Fahrzeugdach silikonkrater, die Seitenwand hitne links unten, die Tür hinten links unten, sowie der Kotflügel vorne rechts unten sind so stark gespachtelt das keine Messung erfolgen kann.

Remarks regarding the Equipment

tires	producer	usage	size	DOT-Code	profile thickness in mm	remarks
 mounted tire VL	Vredestein	summer tyres	205/70R14 95V	2215	7	roadworthy
 mounted tire VR	Vredestein	summer tyres	205/70R14 95V	2215	7	roadworthy
 mounted tire HL	Vredestein	summer tyres	205/70R14 95V	2215	7	roadworthy
 mounted tire HR	Vredestein	summer tyres	205/70R14 95V	2215	7	
 spare wheel						

paint thickness	paint layer thickness	condition
 engine bonnet	358	repainted
 mudguard front right	378	repainted
 right front door	412	repainted
 right back door	398	repainted
 mudguard back right	nicht messbar da nur Spachtelmasse im Bereich Radlauf Kniestück	repainted
 tailgate	369	repainted
 mudguard back left	nicht messbar da nur Spachtelmasse im Bereich Radlauf Kniestück	repainted
 left back door	nicht messbar da nur Spachtelmasse im Be	repainted
 left front door	504	repainted
 mudguard front left	452	repainted
 roof	357	repainted

state of the vehicle at the time of inspection - interior - interior visual inspection

 security belts	
 steering wheel	
 instruments/dashboard	
 air conditioner	nicht vorhanden
 heater/ air filter	
 retractable hardtop/ electric retractable hardtop	
 operating elements	

 key	
 window lifter	
 rear view mirror	
 front seats	
 back seats	
 storage places/ gloves compartement	
 radio	
 floor covering	
 interior disguising	
 headliners	
 horn	
 navigation system	nicht vorhanden

state of the vehicle at the time of inspection - lights	
 headlight	
 dimmed headlights	
 daytime running lamp	nicht vorhanden
 interior lights	
 hazard lights	
 indicator	
 adaptive front-lightning systems (AFS)	nicht vorhanden
 backlight	Rückleuchte hinten rechts gebrochen
 LED tail light	nicht vorhanden
 brakelight	
 reversing light	

state of the vehicle at the time of inspection - exterior	
 Allgemeinzustand	
 rims	
 sealings	
 window glazing	
 windshield	
 windscreen wiper in front	
 windscreen wiper behind	nicht vorhanden
 car locks/ central locking system	
 general state of automotive paint	
 recognizable repainting	Lackeinschlüsse Silikonkrater
 attached parts	Stossleisten mit Gebrauchsspuren
 exterior mirror	

state of the vehicle at the time of inspection - exterior cover	
 bumper front	Gebrauchsspuren
 grille	
 engine bonnet	nachlackiert Lackeinschlüsse
 roof panel	nachlackiert Lackeinschlüsse

🚗 rear lid	nachlackiert Lackeinschlüsse
🚗 side wall/fender back/left	nachlackiert gespachtelt
🚗 door back/left	nachlackiert gespachtelt
🚗 door sill left	
🚗 door front/left	nachlackiert
🚗 mudguard front left	nachlackiert
🚗 mudguard front right	nachlackiert gespachtelt
🚗 door front/right	nachlackiert
🚗 door sill right	nachlackiert
🚗 door back/right	nachlackiert
🚗 side wall/fender back/right	nachlackiert
🚗 bumper back	
🚗 gap dimensions	
🚗 wheel locks	nicht vorhanden

state of the vehicle at the time of inspection - underbody view (as far as testable)

🚗 steering linkage	
🚗 steering gear	
🚗 control arm	
🚗 wheel suspension	
🚗 anti-roll bar front/back	
🚗 shock absorber	
🚗 springs	
🚗 wheel bearing	
🚗 brake cables/hose	
🚗 brake discs	
🚗 brake pad	
🚗 brake line	
🚗 brake abrasion	
🚗 condition of the exhaust system	
🚗 exhaust manifold	
🚗 oil density gear	
🚗 oil density engine	
🚗 oil density differential	
🚗 state of the underbody (general)	

state of the vehicle at the time of inspection - engine compartment view

🚗 motor oil state	
🚗 brake fluid - state	
🚗 cooler status	
🚗 fuel system	
🚗 battery casing/fixation	

state of the vehicle at the time of inspection - test run of the propulsion engine

🚗 starter	
🚗 clutch	nicht vorhanden
🚗 motor running	
🚗 functioning of the instruments	
🚗 conspicuous noises	

☐ conspicuous noises timing chain	nicht vorhanden
--	-----------------

conditions during the test drive

was carried out on	12:30
highest achieved speed	30
was carried out in/on the	company grounds
conspicuous features?	nein

state of the vehicle at the time of inspection - test drive

☐ clutch	Nicht prüfbar
☒ gear change	
☒ Slacking in gear shift	
☒ conspicuous noises	
☒ noticeable vibrations	
☒ functioning of instruments	
☒ brake system responsivity	
☒ braking action	
☒ load change	
☒ accelerator	
☒ motor running	
☒ gearbox	
☒ steering	
☒ directional stability	
☐ cruise control	Nicht prüfbar

Errors in Instrument Cluster/Diagnostic Device

No failures were displayed in the electronic instrument cluster.
--

Existing/known Accident Damage

No damages caused by an accident are recognisable.
--

Conclusion of the Expert

The following damages were identified:

Beleuchtung - Rücklicht - schwerer Mangel - Rückleuchte hinten rechts gebrochen
 Außen - Erkennbare Nachlackierungen - leichter Mangel - Lackeinschlüsse Silikonkrater
 Außen - Anbauteile - leichter Mangel - Stossleisten mit Gebrauchsspuren
 Karosserie Sicht - Stoßfänger vorn - leichter Mangel - Gebrauchsspuren
 Karosserie Sicht - Motorhaube - leichter Mangel - nachlackiert Lackeinschlüsse
 Karosserie Sicht - Dach - leichter Mangel - nachlackiert Lackeinschlüsse
 Karosserie Sicht - Heckklappe - leichter Mangel - nachlackiert Lackeinschlüsse
 Karosserie Sicht - Seitenwand-Kotflügel h. l. - schwerer Mangel - nachlackiert gespachtelt
 Karosserie Sicht - Tür h. l. - schwerer Mangel - nachlackiert gespachtelt
 Karosserie Sicht - Tür v. l. - leichter Mangel - nachlackiert
 Karosserie Sicht - Kotflügel v. l. - leichter Mangel - nachlackiert
 Karosserie Sicht - Kotflügel v. r. - schwerer Mangel - nachlackiert gespachtelt
 Karosserie Sicht - Tür v. r. - leichter Mangel - nachlackiert
 Karosserie Sicht - Tür h. r. - leichter Mangel - nachlackiert
 Karosserie Sicht - Seitenwand-Kotflügel h. r. - leichter Mangel - nachlackiert

No impairment of road safety was found. The vehicle possesses traces of use corresponding to the age and mileage.

The inspection was carried out without exposing the assemblies or dismantling work. There remains a risk of hidden defects or accidental damage.

Important: The condition report of the vehicle was prepared to the best of the expert's knowledge and belief at the time of the inspection under the given possibilities. The report does not establish any liability towards the inspector nor does it contain any guarantee for the buyer or seller. All components/groups not expressly listed will not be assessed as part of the inspection. The inspection is always carried out without disassembly work or disassembly of parts. Not all conceivable load and operating conditions can be achieved within the scope of the visual and functional inspection of the individual components and the test run and therefore not all possible existing defects can be detected within the scope of this inspection. They also depend, among other things, on the prevailing weather and inspection conditions.

intermediary: diepruefer.de GmbH / E.-Ruska-Ring 11 / D-07745
Jena

Das Gutachten wurde am 23.04.2020 um 10:30 Uhr erstellt.

(*1) – in Ordnung - alright = the signs of usage correspond to the age and mileage

(*2) – leichter Mangel - small damage = impairments regarding the value and appearance

(*3) – schwerer Mangel - severe damage = impairments regarding the functionality and security of the vehicle

(*4) – nicht vorhanden - non-existent = does not exist as a part of the vehicle

(*5) – nicht prüfbar - not assessable = could not be assessed properly due to the insufficient conditions

VL (v.l.) – front left

VR (v.r.) – front right

HL (h.l.) – back left

HR (h.r.) – back right



Bild 1: Heck – Heckabschlussblech deformiert



Bild 2: Unterboden



Bild 3: Unterboden



Bild 4: Unterboden



Bild 5: Felge und Reifen h. r.



Bild 6: Felge und Reifen h. l.



Bild 7: Unterboden



Bild 8: Unterboden



Bild 9: Unterboden



Bild 10: Unterboden



Bild 11: Felge und Reifen v. r.



Bild 12: Felge und Reifen v. l.



Bild 13: Unterboden



Bild 14: Unterboden



Bild 15: Unterboden



Bild 16: Unterboden



Bild 17: Unterboden

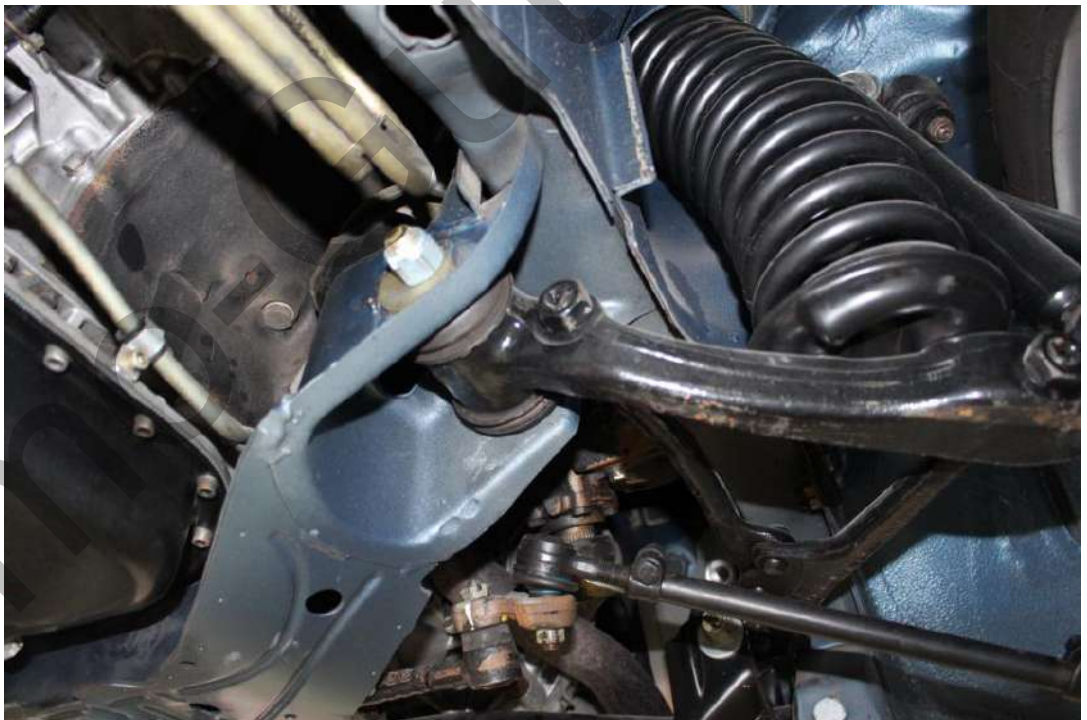


Bild 18: Unterboden



Bild 19: Unterboden – leichte Abschürfung Unterbodenschutz



Bild 20: Unterboden – Abschürfung Unterbodenschutz Wagenheberaufnahmen



Bild 21: Unterboden – Abschürfung Unterbodenschutz Wagenheberaufnahmen



Bild 22: Unterboden – Abschürfung Unterbodenschutz Wagenheberaufnahmen



Bild 23: Unterboden – Abschürfung Unterbodenschutz Wagenheberaufnahmen



Bild 24: Unterboden – Abschürfung Unterbodenschutz Wagenheberaufnahmen



Bild 25: Unterboden – Abschürfung Unterbodenschutz Wagenheberaufnahmen



Bild 26: Frontdiagonale rechts



Bild 27: Heckdiagonale rechts



Bild 28:



Bild 29: Heck



Bild 30: Heckdiagonale links



Bild 31: Frontdiagonale links



Bild 32: Front



Bild 33: Fz.-Ident-Nr.



Bild 34: Motorraum



Bild 35: Innenraum v. r.



Bild 36: Innenraum v. r.



Bild 37: Innenraum hinten



Bild 38: Innenraum hinten



Bild 39: Mittelkonsole



Bild 40: Innenraum hinten



Bild 41: Dokumente/Schlüssel



Bild 42: Koffer-/Laderaum



Bild 43: Innenraum hinten



Bild 44: Innenraum hinten



Bild 45: Innenraum v. l.



Bild 46: Instrumentenansicht



Bild 47: Armaturenbrett



Bild 48:



Bild 49: Kilometerstand



Bild 50: Innenraum v. l.



Bild 51: Fahrzeugschein/ Fahrzeugbrief/ COC-Zertifikat – nicht dokumentiert



Bild 52: Mangel / Schaden – Außen - Anbauteile, Aussenspiegel links geschürft



Bild 53: Aussenspiegel links geschürt



Bild 54: Dach – Kratzer



Bild 55: Dach – Kratzer



Bild 56: Front – Gebrauchsspuren



Bild 57: Mangel / Schaden – Außen - Anbauteile, Gebrauchsspuren



Bild 58: Mangel / Schaden – Außen - Anbauteile, Stossleisten mit Gebrauchsspuren



Bild 59: Front – Gebrauchsspuren



Bild 60: Mangel / Schaden – Karosserie Sicht - Dach, Kratzer



Bild 61: Mangel / Schaden – Außen - Anbauteile, Rückleuchte gebrochen



Bild 62: Mangel / Schaden – Karosserie Sicht - Stoßfänger vorn, Gebrauchsspuren